

THE FACILITY DID NOT RETURN A  
PLAN OF CORRECTION  
THEREFORE, NO POC IS INCLUDED  
WITH THE STATEMENT OF  
DEFICIENCIES (2567 FORM)

Missouri Department of Health and Senior Services

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION	(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER:  <b>29917</b>	(X2) MULTIPLE CONSTRUCTION A. BUILDING: _____  B. WING _____	(X3) DATE SURVEY COMPLETED  <b>07/21/2025</b>
--	--	---	---

NAME OF PROVIDER OR SUPPLIER  <b>PARKWAY SENIOR LIVING, THE</b>	STREET ADDRESS, CITY, STATE, ZIP CODE <b>550 NE NAPOLEON DRIVE BLUE SPRINGS, MO 64014</b>
---	--

(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETE DATE
A2269	<p>19 CSR 30-86.022(11)(B) Sprinkler System Maintenance/Testing</p> <p>Sprinkler Systems. (B) Facilities that have a sprinkler system installed prior to August 28, 2007, shall inspect, maintain, and test these systems in accordance with the requirements that were in effect for such facilities on August 27, 2007. I/II</p> <p>This regulation is not met as evidenced by: Class II</p> <p>Based on observation, record review, and interview on July 21, 2025, the facility failed to install and maintain a complete sprinkler system in accordance with NFPA 13, 1999 edition. The facility census was sixty-eight (68). This affected sixty-eight (68) of sixty-eight (68) residents.</p> <p>Observation at 2:06 P.M., showed the gauges at the sprinkler riser, with a date of April 27, 2020. These gauges shall be calibrated or replaced every five (5) years.</p> <p>Record review at 3:08 P.M., showed on the annual sprinkler system report dated, March 31, 2025; 14.3 Internal Inspection Last date (5 years) 2020 in both wet and dry pipes, 5.3 Gauge maintenance: date last tested (5 years) blank in the wet section and 2020 in the dry section.</p> <p>During an interview on July 21, 2025, at 4:27 P.M., the Plan Ops Director stated, the 5-year inspections are scheduled on August 8, 2025.</p> <p>Record review of the Nation Fire Protection Association (NFPA) 25, 1998 Edition. 2-3.2* Gauges. Gauges shall be replaced every 5 years or tested every 5 years by comparison with a calibrated gauge. Gauges not accurate to</p>	A2269		

Missouri Department of Health and Senior Services  
LABORATORY DIRECTOR'S OR PROVIDER/SUPPLIER REPRESENTATIVE'S SIGNATURE \_\_\_\_\_ TITLE \_\_\_\_\_ (X6) DATE \_\_\_\_\_

Missouri Department of Health and Senior Services

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION	(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER:  <b>29917</b>	(X2) MULTIPLE CONSTRUCTION A. BUILDING: _____  B. WING _____	(X3) DATE SURVEY COMPLETED  <b>07/21/2025</b>
--	--	---	---

NAME OF PROVIDER OR SUPPLIER  <b>PARKWAY SENIOR LIVING, THE</b>	STREET ADDRESS, CITY, STATE, ZIP CODE <b>550 NE NAPOLEON DRIVE BLUE SPRINGS, MO 64014</b>
---	--

(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETE DATE
A2269	<p>Continued From page 1</p> <p>within 3 percent of the full scale shall be recalibrated or replaced.</p> <p>10-2* Obstruction Investigation and Prevention. 10-2.1* To ensure that piping remains clear of all obstructive foreign matter, an obstruction investigation shall be conducted for system or yard main piping wherever any of the following conditions exist:</p> <ul style="list-style-type: none"> <li>(a) Defective intake for fire pumps taking suction from open bodies of water</li> <li>(b) The discharge of obstructive material during routine water test</li> <li>(c) Foreign materials in fire pumps, in dry pipe valves, or in check valves</li> <li>(d) Foreign material in water during drain tests or plugging of inspector 's test connection (s)</li> <li>(e) Plugged sprinklers</li> <li>(f) Plugged piping in sprinkler systems dismantled during building alterations</li> <li>(g) Failure to flush yard piping or surrounding public mains following new installations or repairs</li> <li>(h) A record of broken public mains in the vicinity</li> <li>(i) Abnormally frequent false tripping of a dry valve (s)</li> <li>(j) A system that is returned to service after an extended shutdown (greater than 1 year)</li> <li>(k) There is a reason to believe that the sprinkler system contains sodium silicate or highly corrosive fluxes in the copper systems</li> <li>(l) A system has been supplied with raw water via the fire department connection.</li> </ul> <p>10-2.2* Obstruction Prevention. System shall be examined internally for obstruction where condition exist that could cause obstructed piping. If the condition has not been corrected or the condition is one that could result in obstruction of piping despite any previous flushing procedures that have been performed, the system shall be</p>	A2269		

Missouri Department of Health and Senior Services

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION	(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER:  <b>29917</b>	(X2) MULTIPLE CONSTRUCTION A. BUILDING: _____  B. WING _____	(X3) DATE SURVEY COMPLETED  <b>07/21/2025</b>
--	--	---	---

NAME OF PROVIDER OR SUPPLIER  <b>PARKWAY SENIOR LIVING, THE</b>	STREET ADDRESS, CITY, STATE, ZIP CODE <b>550 NE NAPOLEON DRIVE BLUE SPRINGS, MO 64014</b>
---	--

(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)	(X5) COMPLETE DATE
A2269	Continued From page 2  examined internally for obstruction every 5 years. This investigation shall be accomplished by examining the interior of the dry value or preaction value and by removing two cross main flushing connections.	A2269		