



Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900

Business Name	Daystar at Westwood	Provider Number	000924
Address	2615 SW BARTON ST ,	Approval Status	Approved
City, State, Zip	Seattle, WA 98126	Facility Type	Residential Care

On 7/27/2023 the Office of the State Fire Marshal conducted an inspection at your facility.

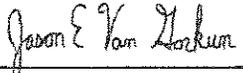
All violations noted during previous related inspection(s) have been corrected.

Owner or Owner's Representative


Signature

EWA THOMAS / EXEC. DIR.
Print Name and Title

Deputy State Fire Marshal Jason Van Gorkum
2803 156 AVE SE
Bellevue WA 98007
(360) 481-3933


Signature

This document was prepared by Residential Care Services for the Locator website.

Right of appeal. Any person may appeal any decision made by the Fire Protection Bureau in accordance with WAC 212-12.



Washington State Patrol
 Fire Protection Bureau
 Phone: (360) 596-3900

Business Name Daystar at Westwood	Provider Number 000924
Address 2615 SW BARTON ST ,	Approval Status Disapproved
City, State, Zip Seattle, WA 98126	Facility Type Residential Care

On 6/20/2023 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

1 Equipment Rooms - Storage in Buildings

Combustible material shall not be stored in boiler rooms, mechanical rooms, electrical equipment rooms or in fire command centers as specified in Section 508.1.5. (IFC 315.3.3 2018)	At time of inspection the following was observed: 1. found area in front of fire panel and entrance to sprinkler room used for storage
--	---

2 Extension Cords

Extension cords and flexible cords shall not be a substitute for permanent wiring and shall be listed and labeled in accordance with UL 817. Extension cords and flexible cords shall not be affixed to structures, extended through walls, ceilings or floors, or under doors or floor coverings, nor shall such cords be subject to environmental damage or physical impact. Extension cords shall be used only with portable appliances. Extension cords marked for indoor use shall not be used outdoors. (IFC 604.5 2018)	At time of inspection the following was observed: 1. Extension cord being used located in Key room ✓
---	---

3 Unapproved conditions

Open junction boxes and open-wiring splices shall be prohibited. Approved covers shall be provided for all switch and electrical outlet boxes. (IFC 604.6, 2018)	At time of inspection the following was observed: 1. cover needed in Key room 2. resident care around plug
---	--

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
Fire Protection Bureau
 Phone: (360) 596-3900

Business Name Daystar at Westwood	Provider Number 000924
Address 2615 SW BARTON ST ,	Approval Status Disapproved
City, State, Zip Seattle, WA 98126	Facility Type Residential Care

On 6/20/2023 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

4 Owner's Responsibility

<p>The owner shall maintain an inventory of all required fire-resistance-rated construction, construction installed to resist the passage of smoke and the construction included in Sections 703 through 707 and Sections 602.4.1 and 602.4.2 of the International Building Code. Such construction shall be visually inspected by the owner annually and properly repaired, restored or replaced where damaged, altered, breached or penetrated. Records of inspections and repairs shall be maintained. Where concealed, such elements shall not be required to be visually inspected by the owner unless the concealed space is accessible by the removal or movement of a panel, access door, ceiling tile or similar movable entry to the space.</p> <p>(IFC 701.6 2018 WAC 51-54A)</p>	<p>The following deficiencies were cited as a result of this inspection:</p> <p>At the time of inspection the following paperwork was not provided:</p> <ol style="list-style-type: none"> 1. Facility will need to identify and establish a schedule for inspection of Fire-Rated construction by 30 days of this inspection. ✓ 2. Annual inspection of fire-resistance-rated construction will need to be performed and completed by end of 2023.
--	---

5 Penetrations - Maintaining Protection

<p>Materials and firestop systems used to protect membrane and through penetrations in fire-resistance-rated construction and construction installed to resist the passage of smoke shall be maintained. The materials and firestop systems shall be securely attached to or bonded to the construction being penetrated with no openings visible through or into the cavity of the construction. Where the system design number is known, the system shall be inspected to the listing criteria and manufacturer's installation instructions.</p> <p>(IFC 703.1 2018)</p>	<p>At time of inspection the following was observed:</p> <ol style="list-style-type: none"> 1. Dry storage in ceiling 2. kitchen manager office 3. kitchen storage above door
--	--

6 Testing and Maintenance

<p>Sprinkler systems shall be tested and maintained in accordance with Section 901.</p> <p>(IFC 903.5 2009, 2012, 2015, 2018)</p>	<p>The following deficiencies were cited as a result of this inspection:</p> <p>At the time of inspection the following paperwork was not provided: ✓</p> <ol style="list-style-type: none"> 1. Quarterly inspections
---	--

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
 Fire Protection Bureau
 Phone: (360) 596-3900

Business Name	Daystar at Westwood	Provider Number	000924
Address	2615 SW BARTON ST ,	Approval Status	Disapproved
City, State, Zip	Seattle, WA 98126	Facility Type	Residential Care

On 6/20/2023 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

7 Gates

<p>Gates serving the means of egress system shall comply with the requirements of this section. Gates used as a component in a means of egress shall conform to the applicable requirements for doors. Exception: Horizontal sliding or swinging gates exceeding the 4-foot (1219 mm) maximum leaf width limitation are permitted in fences and walls surrounding a stadium. (IFC 1010.2 2015, 2018)</p> <p>Except as specifically permitted by this section, egress doors shall be readily openable from the egress side without the use of a key or special knowledge or effort. (IFC 1010.1.9 2015, 2018)</p> <p>Door handles, pulls, latches, locks and other operating devices on doors required to be accessible by Chapter 11 of the International Building Code shall not require tight grasping, tight pinching or twisting of the wrist to operate. (IFC 1010.1.9.1 2015, 2018)</p>	<p>At time of inspection the following was observed:</p> <ol style="list-style-type: none"> 1. gate has been placed in the path of egress. Hardware will need to comply to IFC and IBC.
---	--

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
 Fire Protection Bureau
 Phone: (360) 596-3900

Business Name	Daystar at Westwood	Provider Number	000924
Address	2615 SW BARTON ST ,	Approval Status	Disapproved
City, State, Zip	Seattle, WA 98126	Facility Type	Residential Care

On 6/20/2023 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

8 Circuit identification and Accessibility

<p>10.6.5.2 Circuit Identification and Accessibility. 10.6.5.2.1 The location of the branch circuit disconnecting means shall be permanently identified at the control unit. 10.6.5.2.2 System circuit disconnecting means shall be permanently identified as to its purpose in accordance with the following: (1) "FIRE ALARM" for fire alarm systems (2) "EMERGENCY COMMUNICATIONS" for emergency communications systems (3) "FIRE ALARM/ECS" for combination fire alarm and emergency communications systems 10.6.5.2.3 For fire alarm and/or signaling systems, the circuit disconnecting means shall have a red marking. 10.6.5.2.4 The red marking shall not damage the overcurrent protective devices or obscure the manufacturer's markings. 10.6.5.2.5 The circuit disconnecting means shall be accessible only to authorized personnel. 10.6.5.3 Mechanical Protection. The branch circuit(s) and connections shall be protected against physical damage. 10.6.5.4 Circuit Breaker Lock. Where a circuit breaker is the disconnecting means, a listed breaker locking device shall be installed. 10.6.5.5 Overcurrent Protection. An overcurrent protective device of suitable current-carrying capacity that is capable of interrupting the maximum short-circuit current to which it can be subject shall be provided in each ungrounded conductor. (NFPA 72 10.6.5.2)</p>	<p>At time of inspection the following was observed:</p> <p>1. Fire alarm circuit breaker in the electrical room is missing the required lock device - locking breaker in the 'ON' position.</p>
--	--

9 NFPA 80 Fire /Smoke Dampers Inspection and Testing

<p>19.4 Periodic Inspection and Testing. 19.4.1 Each damper shall be tested and inspected 1 year after installation. 19.4.1.1 The test and inspection frequency shall then be every 4 years, except in hospitals, where the frequency shall be every 6 years.</p>	<p>The following deficiencies were cited as a result of this inspection:</p> <p>At the time of inspection the following paperwork was not provided:</p> <p>1. Fire/smoke damper 4-year inspection will need to be performed and documented</p>
---	--

Farrington Air Quality

This document was prepared by Residential Care Services for the Locator website.



**Washington State Patrol
Fire Protection Bureau
Phone: (360) 596-3900**

Business Name Daystar at Westwood	Provider Number 000924
Address 2615 SW BARTON ST ,	Approval Status Disapproved
City, State, Zip Seattle, WA 98126	Facility Type Residential Care

On 6/20/2023 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

10 NFPA 80 Fire Door Inspection and Testing

5.2.1 Inspection and Testing. Upon completion of the installation, door, shutters, and window assemblies shall be inspected and tested in accordance with 5.2.4.

5.2.4 Periodic Inspection and Testing.

5.2.4.1 Periodic inspections and testing shall be performed not less than annually.

5.2.2.4 A record of all inspections and testing shall be provided that includes, but is not limited to, the following information:

1. Date of inspection
2. Name of facility
3. Address of facility
4. Name of person(s) performing inspections and testing
5. Company name and address of inspecting company
6. Signature of inspector of record
7. Individual record of each inspected and tested fire door assembly
8. Opening identifier and location of each inspected and tested fire door assembly
9. Type and description of each inspected and tested fire door assembly
10. Verification of visual inspection and functional operation
11. Listing of deficiencies in accordance with 5.2.3, Section 5.3, and Section 5.4

And the following shall be checked:

1. Labels are clearly visible and legible
2. No open holes or breaks exist in surfaces of either the door or frame
3. Glazing, vision light frames, and glazing beads are intact and securely fastened in place, if so equipped.
4. The door, frame, hinges, hardware, and non-combustible threshold are secured, aligned and in working order with no visible signs of damage
5. No parts are missing or broken
6. Door clearances do not exceed clearances listed in 4.8.4 and 6.3.1.7
7. The self-closing device is operational; that is, the active door completely closes when operated from the full open position
8. If a coordinator is installed, the inactive lead close before the active lead

The following deficiencies were cited as a result of this inspection:

At the time of inspection the following paperwork was not provided:

1. Fire door annual inspection will need to be performed and documented

This document was prepared by Residential Care Services for the Locator website.



Washington State Patrol
 Fire Protection Bureau
 Phone: (360) 596-3900

Business Name	Daystar at Westwood	Provider Number	000924
Address	2615 SW BARTON ST ,	Approval Status	Disapproved
City, State, Zip	Seattle, WA 98126	Facility Type	Residential Care

On 6/20/2023 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
9. Latching hardware operates and secures the door when it is in the closed position 10. Auxiliary hardware items that interfere or prohibit operation are not installed on the door or frame 11. No field modification to the door assembly have been performed that void the label. 12. Meeting edge protection, gasketing and edge seals where required, are inspected to verify their presence and intertie 13. Signage affixed to a door meets the requirements listed in 4.1.4	

Next inspection scheduled on or after: 7/20/2023

Right of appeal. Any person may appeal any decision made by the Fire Protection Bureau in accordance with WAC 212-12.

Owner or Authorized Representative

[Handwritten Signature]
 Signature

EXEC - DIR.

 Print Name and Title

Deputy State Fire Marshal Jason Van Gorkum
 2803 156 AVE SE
 Bellevue WA 98007
 (360) 481-3933

[Handwritten Signature]

 Signature

This document was prepared by Residential Care Services for the Locator website.