



**Washington State Patrol
Fire Protection Bureau**
Phone: (360) 596-3900

Business Name	Bellingham at Orchard (The)	Provider Number	2576
Address	848 W ORCHARD DR ,	Approval Status	Disapproved
City, State, Zip	Bellingham, WA 98225	Facility Type	Residential Care

On 01/13/2025 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

1 Duct and Air Transfer Openings - Maintaining Protection

Dampers protecting ducts and air transfer openings shall be inspected and maintained in accordance with NFPA 80 and NFPA 105. Other products or materials used to protect the openings for ducts and air transfer openings shall be securely attached to or bonded to the construction containing the duct or air transfer opening, without visible openings through or into the cavity of the construction. Any damaged products or materials protecting duct and air transfer openings shall be repaired, restored or replaced.	Facility is unable to provide documentation for the 4 year fire and smoke damper inspection without deficiencies.
---	---

(IFC 706.1 2018)

2 Testing and Maintenance

Sprinkler systems shall be tested and maintained in accordance with Section 901.	Corrected
--	-----------

(IFC 903.5 2021)

Next inspection scheduled on or after: 02/12/2025

Right of appeal. Any person may appeal any decision made by the Fire Protection Bureau in accordance with WAC 212-12.

Owner or Authorized Representative

Signature

Deputy State Fire Marshal Brandon G. Brown
16778 146 ST SE
Monroe WA 98272
(360) 791-0037

Signature

Michael Malmin Executive Director
Print Name and Title



**Washington State Patrol
Fire Protection Bureau**
Phone: (360) 596-3900

Business Name	Bellingham at Orchard (The)	Provider Number	2576
Address	848 W ORCHARD DR ,	Approval Status	Disapproved
City, State, Zip	Bellingham, WA 98225	Facility Type	Residential Care

On 10/03/2024 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

1 Duct and Air Transfer Openings - Maintaining Protection

Dampers protecting ducts and air transfer openings shall be inspected and maintained in accordance with NFPA 80 and NFPA 105. Other products or materials used to protect the openings for ducts and air transfer openings shall be securely attached to or bonded to the construction containing the duct or air transfer opening, without visible openings through or into the cavity of the construction. Any damaged products or materials protecting duct and air transfer openings shall be repaired, restored or replaced.	Facility is unable to provide documentation for the 4 year fire and smoke damper inspection without deficiencies.
---	---

(IFC 706.1 2018)

2 Testing and Maintenance

Sprinkler systems shall be tested and maintained in accordance with Section 901.	Facility is unable to provide documentation for the annual forward flow test in accordance with NFPA 25.
--	--

(IFC 903.5 2021)

3 Internally Illuminated Exit Signs

Electrically powered, self-luminous and photoluminescent exit signs shall be listed and labeled in accordance with UL 924 and shall be installed in accordance with the manufacturer's instructions and Section 1203. Exit signs shall be illuminated at all times.	Corrected
---	-----------

(IFC 1013.5 2021)



**Washington State Patrol
Fire Protection Bureau**
Phone: (360) 596-3900

Business Name	Bellingham at Orchard (The)	Provider Number	2576
Address	848 W ORCHARD DR ,	Approval Status	Disapproved
City, State, Zip	Bellingham, WA 98225	Facility Type	Residential Care

On 10/03/2024 the Office of the State Fire Marshal conducted an inspection at your facility.


Code Requirement	Statement of Violation

Next inspection scheduled on or after: 11/02/2024

Right of appeal. Any person may appeal any decision made by the Fire Protection Bureau in accordance with WAC 212-12.

Owner or Authorized Representative


Signature


Print Name and Title

Deputy State Fire Marshal Brandon G. Brown
16778 146 ST SE
Monroe WA 98272
(360) 791-7037


Signature



**Washington State Patrol
Fire Protection Bureau**
Phone: (360) 596-3900

Business Name	Bellingham at Orchard (The)	Provider Number	2576
Address	848 W ORCHARD DR ,	Approval Status	Disapproved
City, State, Zip	Bellingham, WA 98225	Facility Type	Residential Care

On 08/05/2024 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

1 Abatement of Electrical Hazards

Abatement of unsafe conditions and electrical hazards. Conditions that constitute an electrical shock or fire hazard shall be abated.. (IFC 603.2 2021)	Corrected
--	-----------

2 Duct and Air Transfer Openings - Maintaining Protection

Dampers protecting ducts and air transfer openings shall be inspected and maintained in accordance with NFPA 80 and NFPA 105. Other products or materials used to protect the openings for ducts and air transfer openings shall be securely attached to or bonded to the construction containing the duct or air transfer opening, without visible openings through or into the cavity of the construction. Any damaged products or materials protecting duct and air transfer openings shall be repaired, restored or replaced. (IFC 706.1 2018)	Facility is unable to provide documentation for the 4 year fire and smoke damper inspection without deficiencies.
---	---

3 Testing and Maintenance

Sprinkler systems shall be tested and maintained in accordance with Section 901. (IFC 903.5 2021)	1. As per documents provided the annual sprinkler inspection conducted on 4/23/24 had deficiencies noted that have not been corrected. 2. Facility is unable to provide documentation for the 3 year dry system full flow trip test. 3. Facility is unable to provide documentation for the annual forward flow test in accordance with NFPA 25.
--	--

4 Inspection, Testing and Maintenance

The maintenance and testing schedules and procedures for fire alarm and fire detection systems shall be in accordance with Sections 907.8.1 through 907.8.5 and NFPA 72. Records of inspection, testing and maintenance shall be maintained. (IFC 907.8 2021)	Corrected
--	-----------



**Washington State Patrol
Fire Protection Bureau**
Phone: (360) 596-3900

Business Name	Bellingham at Orchard (The)	Provider Number	2576
Address	848 W ORCHARD DR ,	Approval Status	Disapproved
City, State, Zip	Bellingham, WA 98225	Facility Type	Residential Care

On 08/05/2024 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
5 Internally Illuminated Exit Signs	
Electrically powered, self-luminous and photoluminescent exit signs shall be listed and labeled in accordance with UL 924 and shall be installed in accordance with the manufacturer's instructions and Section 1203. Exit signs shall be illuminated at all times. (IFC 1013.5 2021)	The internally illuminated exit signs would not illuminate when the activation test button was pushed in the following locations: 1. Near room 1 2. Near the beauty salon 3. Near room 31


Emergency and standby power systems shall be maintained in accordance with NFPA 110 and NFPA 111 such that the system is capable of supplying service within the time specified for the type and duration required. (IFC 1203.4 2021)	Corrected
--	-----------

Next inspection scheduled on or after: 09/04/2024

Right of appeal. Any person may appeal any decision made by the Fire Protection Bureau in accordance with WAC 212-12.

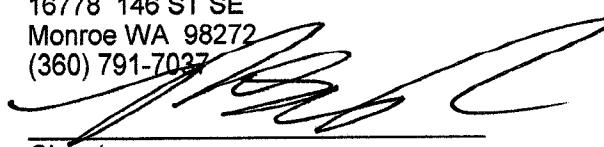
Owner or Authorized Representative


Signature


Print Name and Title

ESD

Deputy State Fire Marshal Brandon G. Brown
16778 146 ST SE
Monroe WA 98272
(360) 791-7037


Signature

Initials of Authorized Facility Representative: _____



**Washington State Patrol
Fire Protection Bureau**
Phone: (360) 596-3900

Business Name	Bellingham at Orchard (The)	Provider Number	2576
Address	848 W ORCHARD DR	Approval Status	Disapproved
City, State, Zip	Bellingham, WA 98225	Facility Type	Residential Care

On 06/18/2024 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

1 Abatement of Electrical Hazards

Abatement of unsafe conditions and electrical hazards. Conditions that constitute an electrical shock or fire hazard shall be abated.. (IFC 603.2 2021)	There was an electrical outlet with a broken faceplate in the kitchen, exposing the inner electrical fixture.
--	---

2 Duct and Air Transfer Openings - Maintaining Protection

Dampers protecting ducts and air transfer openings shall be inspected and maintained in accordance with NFPA 80 and NFPA 105. Other products or materials used to protect the openings for ducts and air transfer openings shall be securely attached to or bonded to the construction containing the duct or air transfer opening, without visible openings through or into the cavity of the construction. Any damaged products or materials protecting duct and air transfer openings shall be repaired, restored or replaced. (IFC 706.1 2018)	Facility is unable to provide documentation for the 4 year fire and smoke damper inspection without deficiencies.
---	---

3 Testing and Maintenance

Sprinkler systems shall be tested and maintained in accordance with Section 901. (IFC 903.5 2021)	1. As per documents provided the annual sprinkler inspection conducted on 4/23/24 had deficiencies noted that have not been corrected. 2. Facility is unable to provide documentation for the 3 year dry system full flow trip test. 3. Facility is unable to provide documentation for the annual forward flow test in accordance with NFPA 25.
--	--

4 Inspection, Testing and Maintenance

The maintenance and testing schedules and procedures for fire alarm and fire detection systems shall be in accordance with Sections 907.8.1 through 907.8.5 and NFPA 72. Records of inspection, testing and maintenance shall be maintained. (IFC 907.8 2021)	The fire alarm panel is in trouble status.
--	--



**Washington State Patrol
Fire Protection Bureau**
Phone: (360) 596-3900

Business Name	Bellingham at Orchard (The)	Provider Number	2576
Address	848 W ORCHARD DR ,	Approval Status	Disapproved
City, State, Zip	Bellingham, WA 98225	Facility Type	Residential Care

On 06/18/2024 the Office of the State Fire Marshal conducted an inspection at your facility.

Code Requirement	Statement of Violation
------------------	------------------------

5 Internally Illuminated Exit Signs

Electrically powered, self-luminous and photoluminescent exit signs shall be listed and labeled in accordance with UL 924 and shall be installed in accordance with the manufacturer's instructions and Section 1203. Exit signs shall be illuminated at all times.

(IFC 1013.5 2021)

The internally illuminated exit signs would not illuminate when the activation test button was pushed in the following locations:

1. Near room 1
2. Near the beauty salon
3. Near the emergency exit from Baker to Salish
4. Near room 31
5. Near room 7
6. In community room

6 Maintenance

Emergency and standby power systems shall be maintained in accordance with NFPA 110 and NFPA 111 such that the system is capable of supplying service within the time specified for the type and duration required.

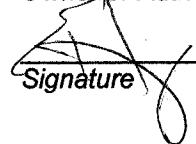
(IFC 1203.4 2021)


Facility is unable to provide documentation for the annual servicing of the emergency generator.

Next inspection scheduled on or after: 07/18/2024

Right of appeal. Any person may appeal any decision made by the Fire Protection Bureau in accordance with WAC 212-12.

Owner or Authorized Representative


Signature


Print Name and Title

Deputy State Fire Marshal Brandon G. Brown
16778 146 ST SE
Monroe WA 98272
(360) 791-7037


Signature

Initials of Authorized Facility Representative: _____